Closing the Position Loop with External Feedback for AKD2G

Rev. B | Jake Jacobs | 5/15/23

<u>Key takeaways</u>

- Set which feedback will be used to close the position loop. This can be set in the Feedback screen under the Axis' Settings. For more details see the "Setting the external feedback to close the position loop" section of this document below.
- Determine the scaling factor (PIN and POUT values) by using the Units screen and entering the systems mechanics. For more details see the "Scaling for external linear feedback Units Screen" section of this document below.
- Using the PIN and POUT values from the Units screen, set the AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT to scale the physical system. For more details see the "Scaling for external linear feedback AXIS#.PL.KFB" section of this document below.
- Scaling for external rotary feedback is a different approach compared to linear encoders. For more details see the "Scaling for external rotary feedback – AXIS#.PL.KFB" section of this document below.
- Set AXIS#.MOTOR.PITCH to 1 in the terminal screen
- Use the AXIS#.PL.KFB.PIN to set the direction of the system. For more details see the "Determining direction of motion" section of this document below.

Introduction – Benefits and Purpose

For most users, closing the position loop using an external encoder is used so feedback is generated directly from the application, rather than the rotary motor driving the application. Some benefits to using an external encoder are:

- Higher positioning precision is directly linked to the application which can support any backlash that may be seen on the motor's side.
- Having the ability to use encoders that fit closer to the application's needs (i.e. linear encoders for linear applications)
- Increased confidence the system is behaving as intended.

Initial safety considerations

Improperly scaled systems could possibly run away and lead to damaged mechanisms and/or harm to users. It is recommended to set speed and current limits to safe levels determined by the users before operation.

Setting the external feedback to close the position loop

Under "Device Settings" in the Workbench software there is the "Feedback Devices" menu. The different feedback devices relate to a specific input on the drive, as seen in **Figure 1**. For example, Feedback 1 is related to the X1 input, Feedback 3 is X23, and so on. In **Figure 1** Feedback 3 (X23) is being used to close the commutation, velocity, and position loops.

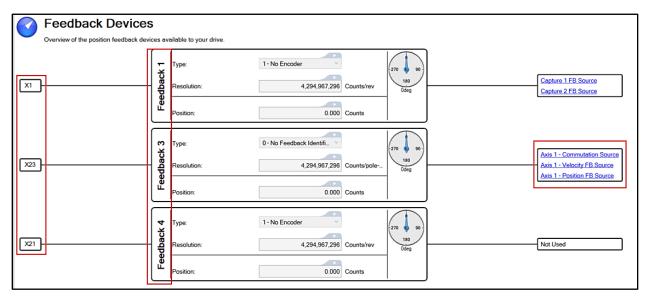


Figure 1. Main feedback device screen in Workbench.

The feedback being used to close the commutation, velocity, and position loops can be changed in the Feedback screen under Axis $\# \rightarrow$ Settings \rightarrow Feedback. For instance, if a linear encoder is being used to close the position loop through the X23 input but would like to use X1 for commutation and velocity their settings would be similar to **Figure 2**.

(Configures the connection of feedbacks and loop sources for this axis.						
с	Control Loop Sources						
	Commutation:	1-Feedback 1 V		45 - SFD3 (Smart Feedback Device Gen3)	Configure Feedback 1		
	Velocity Loop:	0 - Same as commutation ~	A Not used	45 - SFD3 (Smart Feedback Device Gen3)	Configure Feedback 1		
	Position Loop:	3 - Feedback 3 ~	A Not used	30 - EnDat Analog	Configure Feedback 3		
м	Motion Sources						
	Electronic Gearing:	0-None v	A Not used				

Figure 2. Setting external feedback to close position loop.

Scaling for external linear feedback – Units Screen

Systems can vary in several different ways such as gear box ratios, leadscrew pitches, and pulley diameters. With all these variations, scaling is crucial for external feedbacks to work properly. The focus of this app note will be on a leadscrew application. However, the following instructions can be translated to other system types as well.

The Units screen, found under Axis # \rightarrow Settings, is the starting point for scaling. Here the mechanics can be selected that fits the system and input gear ratios and/or system specific mechanics. For the leadscrew, this would be the pitch of the leadscrew.

The position unit can be changed to "Custom (mechanics dependent)," because with linear applications we want to work with linear units, not rotary. At the same time, the custom position unit can be changed to the desired linear units.

Click on the "More >>" button to view the feedback position, PIN, POUT, and Label which should show the linear units being used for the application. The PIN and POUT values are equal to your AXIS#.UNIT.PIN and AXIS#.UNIT.POUT parameters. Note that the AXIS#.UNIT.POUT and AXIS#.UNIT.PIN parameters do not affect the physical scaling of the system, but rather they affect the feedback value displayed by AXIS#.PL.FB in workbench. These values are shown in **Figure 3**. These values will be helpful when scaling the AXIS#.PL.FB to the real-world value by using AXIS#.PL.KFB.

Set AXIS#.PL.KFB.PIN equal to the value of AXIS#.UNIT.POUT. Set AXIS#.PL.KFB.POUT equal to the value of AXIS#.UNIT.PIN.

Units				
You can selec	ct the units used for positions, velocities and accelerations			
Select Type of Mechan	ics: Lead Screw ~			
 None Turns Teeth 	Lead:			
Motor: Load:				
Position Unit:	3 - Custom (mechanics dependent) $ \lor$			
Velocity Unit:	0 - RPM (motor shaft) V			
Acceleration Unit:	0 - RPM/s (motor shaft)			
Custom Position Unit:	mm ~			
Modbus Unit:	Goto Modbus			
Less <<				
Position:	0.000 mm			
PIN:	1			
POUT:	3			
Label:	mm			

Figure 3. Leadscrew application with 3:1 gearbox and leadscrew pitch of 1mm/rev.

Scaling for external linear feedback – AXIS#.PL.KFB

AXIS#.PL.KFB is dependent on two values: AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT. See equation 2 for this relationship.

$$AXIS\#.PL.KFB = \frac{AXIS\#.PL.KFB.PIN}{AXIS\#.PL.KFB.POUT}$$
1)

AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT are important variables, because this is what will provide the scaling for the system so the position feedback seen in Workbench matches the real world. AXIS#.PL.KFB.PIN has a range of - 2,147,483,648 to 2,147,483,647, whereas AXIS#.PL.KFB.POUT has a range of 1 to 2,147,483,647. The reason for this range is because the sign of AXIS#.PL.KFB.PIN will be used to set your positive and negative direction.

While AXIS#.PL.KFB can be written to, it is recommended to use AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT to calculate AXIS#.PL.KFB instead due to possible precision loss. For example, the gear ratio 1:3 is precisely

represented with the fraction 1/3 but lacks precision as a floating-point number 0.3333333. Example 1 shows the scaling using the units screen.

AXIS#.MOTOR.PITCH will need to be changed from the default value of 32 to 1, or else the motor will run away.

Scaling for external rotary feedback – AXIS#.PL.KFB

The approach to scaling rotary feedback types is different when compared to linear encoders. With rotary feedback, the only gear ratios in the system that matter are the ones between the external encoder and the mechanical load that the user wishes to base position feedback on. All mechanical gearing between the motor and the load does not apply to determining the values of AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT. For example, if the rotary feedback is directly coupled to the load that the user wants to base position on, then the AXIS#.PL.KFB scaling value will be 1. However, if the encoder is geared to the load that the position feedback will be based on, that gear ratio will need to be scaled through the AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT values. Equation 2 shows the relationship and Example 2 below gives an example of this calculation.

$$\frac{Mechanical System Revs}{Rotary Encoder Revs} = \frac{AXIS \#.PL.KFB.PIN}{AXIS \#.PL.KFB.POUT}$$
2)

AXIS#.MOTOR.PITCH will need to be changed from the default value of 32 to 1, or else the motor will run away.

Determining direction of motion

Now that the PIN and POUT values are established, determining what will be the positive and negative direction of the system as well as the home position is the next step.

Caution: Before any motion is applied to the system, it is recommended to go into the Limits screen and lower the positive and negative current and speed limits, so both the user and system are safe.

AXIS#.PL.FB can be added to the watch window to monitor how position value changes with motion. If the system moves in the intended positive direction, but AXIS#.PL.FB moves negative, a negative sign will be needed for AXIS#.PL.KFB.PIN. If movement by hand is not possible, applying a slow pulsed motion in the Service Motion or the Jog function screen will work. Once the direction is determined, the system can be homed, and motion tasking can begin.

Example 1 – Using the Units Screen for Scaling with Linear Encoder:

Application Description:

- A leadscrew application that uses a 3.14:1 gear box and a 5mm screw lead.
- The position loop will be closed using an EnDat 2.2 linear encoder connected to X23. SFD3, the motor's feedback device, is closing commutation and velocity loops through X1.

Feedback Screen Setup:

Here the EnDat Analog linear encoder is being used to close the position loop:

(🗑 Feedback						
	Configures the connection of feedbacks and loop sources for this axis.						
C	Control Loop Sources						
	Commutation:	1 - Feedback 1 V	45 - SFD3 (Smart Feedback Device Gen3)	Configure Feedback 1			
	Velocity Loop:	0 - Same as commutation V 🛆 Not used	45 - SFD3 (Smart Feedback Device Gen3)	Configure Feedback 1			
	Position Loop:	3 - Feedback 3 🗸 🔨 Not used	30 - EnDat Analog	Configure Feedback 3			
м	Motion Sources						
	Electronic Gearing:	0-None Not used					

Here the EnDat Analog is being shown to close the position loop in the "Feedback Devices" screen:

Feedback Device		2 <u>Lee</u>
X1	Type: 45 - SFD3 (Smart Feed.) 0 90 Resolution: 16,777,216 Enc Cnts/rev 121deg Position: 1,440,568,093 Counts 121deg	Axis 1 - Commutation Source Axis 1 - Velocity FB Source Capture 1 FB Source Capture 2 FB Source
X23	Type: 30 - EnDet Analoa Resolution: 838,860,800 Position: 22,148,953,312 Counts	Axis 1 - Position FB Source
X21	Type: Resolution: Position: 1 - No Encoder 0 Enc Cnts/rev Position: 0 Counts	Not Used

Units Screen Setup:

314 in Motor and 100 in Load are used to define the 3.14:1 gearbox attached to the motor. 5mm in Lead is used to define the pitch of the leadscrew in the application. Since the system position loop is being closed with a linear encoder, changing the position units to linear units makes sense. Here, millimeters (mm) are being used to measure position.


You can sele	ct the units used for positions, velocities and	accelerations.
Select Type of Mechanic	cs: Lead Screw V	
O None		
Tums	Lead:	
◯ Teeth		
Motor: Load:	5.000 mm	
314	100	
	0	
	-1	
1. Av. ()		
Position Unit:	3 - Custom (mechanics dependent) \sim	
Velocity Unit:	0 - RPM (motor shaft) V	
Acceleration Unit:	0 - RPM/s (motor shaft) V	
Custom Position Unit:	mm 🗸 🗸	
Modbus Unit:	Goto Modbus	
Less <<		
Position:	0.000	mm
PIN:	250	
POUT:	157	
Label:	nm]

Set these parameters in the watch window or the terminal screen:

- AXIS1.PL.KFB.PIN = 157 (or -157 if direction needs to be switched)
- AXIS1.PL.KFB.POUT = 250
- AXIS1.MOTOR.PITCH = 1

Example 2 – Calculating AXIS1.PL.KFB Based on Mechanics for External Rotary Feedback

System Description:

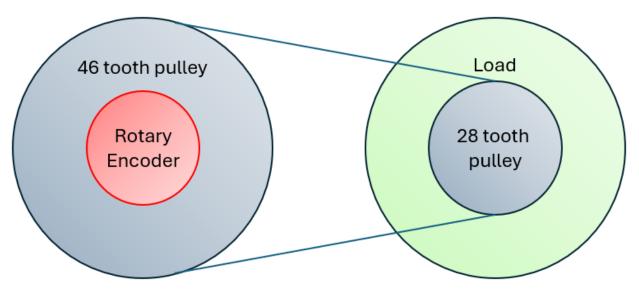

- The secondary encoder is geared with a belt and a pulley to a mechanical load where the position units are going to be scaled to
- The pulley attached to the encoder has 46 teeth
- The mechanical load is attached to a pulley with 28 teeth

To find AXIS1.PL.KFB.PIN and AXIS1.PL.KFB.POUT, the following calculation done:

 $\frac{1 \text{ load revs}}{28 \text{ teeth movment}} * \frac{46 \text{ teeth movement}}{1 \text{ encoder rev}} = \frac{46 \text{ load revs}}{28 \text{ encoder revs}} = \frac{23 \text{ load revs}}{14 \text{ encoder revs}}$

Following the relationship of equation 2 yields the scaling factor applied to the external encoder's position feedback to give the mechanical load's position:

- AXIS1.PL.KFB.PIN=23 (or -23 if direction needs to be switched)
- AXIS1.PL.KFB.POUT=14
- AXIS1.PL.KFB = (23/14) = 1.642857

In this case, the example doesn't show how the load is being driven by the motor. Whatever gearing there may be between the motor and the load is not used in determining the values of AXIS#.PL.KFB.PIN and AXIS#.PL.KFB.POUT.